

Thayer Lake Shoreline Survey 2017

By Tip of the Mitt Watershed Council

Report written by:

Dave D. Edwards

Monitoring and Research Director

Data collected by Watershed Protection Team 2017

Table of Contents

List of Figures.....	3
List of Tables.....	3
INTRODUCTION	5
Background.....	5
Shoreline Development Impacts	5
Background of Study Area	9
SHORELINE SURVEY METHODS	15
Parameters	15
Data Processing	18
<i>Cladophora</i>	19
Shoreline alterations.....	23
Erosion	23
DISCUSSION	25
RECOMMENDATIONS.....	28
LITERATURE AND DATA REFERENCED	30

List of Figures

Figure 1 Map of Thayer Lake Depths (bathymetry) and surface watershed.....	10
Figure 2 Thayer Lake Total Phosphorus Trends from 2008 through 2017	12
Figure 3 Thayer Lake Nitrogen Trends from 1995 through 2016	12
Figure 4 Thayer Lake Chloride Trends from through 2016.....	13
Figure 5 Average Secchi Disk depths collected by Thayer Lake Volunteers since 2008.....	14
Figure 6 Average Chlorophyll-a concentrations collected by Thayer Lake Volunteers. Missing values indicate data not available for that particular year.....	14
Figure 7 Trophic Status Index (TSI) from data collected by Thayer Lake Volunteers since 2008.	15
Figure 8 Cladophora density around Thayer Lake Shoreline.....	20
Figure 9 Greenbelt Scores around Thayer Lake shoreline.....	22
Figure 10 Erosion severity around Thayer Lake shoreline.....	24

List of Tables

Table 1 Thayer Lake Surface Watershed Land Cover 2016	11
Table 2 Categorization system for Cladophora density.....	16
Table 3 Cladophora density results.....	19
Table 4 Greenbelt rating results	21
Table 5 Shoreline alteration results.....	23
Table 6 Shoreline erosion severity results.....	23
Table 7 Shore Survey statistics from Northern Michigan Lakes	27

SUMMARY

During the early summer of 2017, Tip of the Mitt Watershed Council conducted a shoreline survey of Thayer Lake. The survey was a part of a comprehensive shoreline survey for the entire Elk River Chain of Lakes. Surveys were designed to document conditions that can impact water quality, including the three biggest threats to inland lakes: nutrient pollution, habitat loss, and shoreline erosion. The shoreline assessment was conducted on a parcel-by-parcel basis around the entirety of Thayer Lake. Survey results indicate that a majority of Thayer Lake shoreline contains natural and native vegetation growth. However, some human activity around Thayer Lake shoreline may be impacting the lake ecosystem and water quality. Improving areas with poor greenbelts will help the character and quality of Thayer Lake by reducing nutrient pollution and sediments from erosion entering the Lake.

INTRODUCTION

Background

During the late spring and early summer of 2017, a shoreline survey was conducted on Thayer Lake by the Tip of the Mitt Watershed Council to document shoreline conditions that impact water quality. Thayer Lake was one of 15 lakes surveyed during 2016 and 2017 as a part of a broader effort to document shoreline conditions within the entire Elk River Chain of Lakes. The entire shoreline was surveyed to document the following: algal (*Cladophora*) growth as a nutrient pollution indicator, erosion, shoreline alterations (including drain pipes), greenbelts, and tributary inlets and outlets.

According to Watershed Council records, Thayer Lake has not yet had a shoreline survey to date. This first survey offers important baseline data for comparison in future years. The 2017 survey results below provide a comprehensive dataset documenting shoreline conditions on Thayer Lake that can be used as a lake management tool.

Shoreline Development Impacts

Lake shorelines are an important interface linking the landscape to water within a watershed. A shoreline is the area in which a transfer of water and nutrients occurs from land to water. This transitional zone does not necessarily have an exact line between the landscape and water as lake shorelines vary based on shape, size, and vegetation. Accordingly, human activities along shorelines will have varying potential for degrading water quality of Thayer Lake. Development of shoreline properties for residential, commercial, or other use have an impact on Thayer Lake in a variety of ways and in various degrees. For example, as more shoreline vegetation is removed, the potential for nutrients and pollutants to run off the landscape and enter Thayer Lake increases. Additionally, as the Thayer Lake Watershed terrain is altered, sediments and nutrients from eroded areas can often end up in Thayer Lake.

While nutrients are necessary to sustain a healthy aquatic ecosystem, excess nutrients will stimulate nuisance growth of both macrophytes (aquatic plants that grow in or near water and

are either emergent, submergent, or floating) and algae. Additionally, algal blooms pose a public health risk as some species (i.e. Cyanobacteria - blue green algae) produce toxins, including hepatotoxins (toxins that cause liver damage) and neurotoxins (toxins that affect the nervous system). Excess plant and algal growth can degrade water quality by depleting the ecosystem's dissolved oxygen. As algal growth increases and individuals begin to die, the aerobic activity of decomposers deplete dissolved oxygen, particularly in the deeper waters of stratified lakes. In general, small lakes are more prone to nutrient pollution than large lakes. With the increased volume, large lakes tend to have greater stores of dissolved oxygen and increased dilution of nutrients. By contrast, small lakes generally have a lesser ability to dilute nutrients and extensive shallow areas that can support aquatic plant growth. Excess nutrients enter surface waters through a variety of natural and cultural (human) sources.

Natural sources of nutrients include stream inflows, groundwater inputs, surface runoff, organic inputs from riparian (shoreline) areas, and atmospheric deposition. Springs and seeps, streams, and artesian wells are often naturally high in nutrients due to the geologic strata they encounter. Nearby wetland seepages may also discharge nutrients at certain times of the year. Cultural (human) sources include septic systems, fertilizers, and stormwater runoff from roads, driveways, parking lots, roofs, and other impervious surfaces. Poor agricultural and forestry practices, which oftentimes result in soil erosion, and wetland destruction also contribute to nutrient pollution. Moreover, some cultural sources (e.g., malfunctioning septic systems) pose a potential health risk due to bacterial and viral contamination. Severe nutrient pollution is detectable through chemical analyses of water samples, physical water measurements, and the utilization of biological indicators.

Although chemical analyses of water samples to check for nutrient pollution can be effective, they are oftentimes more labor intensive and cost prohibitive than other methods. Typically, water samples are analyzed to determine nutrient concentrations (usually the forms of phosphorus and nitrogen), but other chemical constituents, such as chloride, can be measured. Physical measurements, such as water temperature and conductivity (the ability for water to

conduct an electrical current), are primarily used to detect excess nutrients entering a water body. Biologically, nutrient pollution can be detected along the lake shore by noting the presence of *Cladophora* algae, a biological indicator. Observed increases of *Cladophora* presence can be an indicator of elevated nutrients along the shoreline.

Cladophora is a branched, filamentous green algal species that occurs naturally in relatively small amounts in Northern Michigan lakes. *Cladophora* occurrence is governed by specific environmental requirements for temperature, substrate, sunlight, and nutrients. This algal bio-indicator is found most commonly in the wave splash zone and shallow shoreline areas of lakes and grows best on stable substrates such as rocks and logs. Artificial substrates such as concrete or wooden seawalls are also suitable growth areas. *Cladophora* prefers water temperatures in a range of 50 to 70 degrees Fahrenheit, which means that the optimal time for growth and detection in Northern Michigan lakes is usually from middle of May to early July, and early to middle of September. The nutrient availability in Northern Michigan lakes is typically less than what is needed for *Cladophora* to achieve large, dense growth. Therefore, shoreline locations where relatively high concentrations of nutrients, particularly phosphorus, are entering a lake can be identified by noting the presence of *Cladophora*.

Although the growth of *Cladophora* can be influenced by factors such as current patterns, shoreline topography, substrate composition, and wave action, the presence or absence of any significant growth can be a powerful lake-wide screening tool. The existence of chronic nutrient availability along the shoreline can be revealed and *Cladophora* presence can assess the effectiveness of any remedial actions. Comparing the total number of algal growth areas along the shoreline over time can reveal trends in nutrient inputs to a lake. One factor contributing to nutrient input is bank erosion.

Erosion along the shoreline can degrade the lake's water quality. Stormwater runoff carries sediments into the lake that can reduce organism respiration by clogging the gills of fish, insects, and other aquatic organisms. Excessive sediments can smother fish spawning beds and

fill interstitial spaces along the lake bottom that provide habitat for a variety of aquatic organisms. Suspended sediments absorb sunlight energy and increase water temperatures. In addition, nutrients (particularly phosphorus) adhere to sediments that wash in from eroded areas, which can lead to nuisance aquatic plant growth and algal blooms. To help prevent erosion and runoff of sediments and nutrients, healthy shoreline greenbelts are essential.

Shoreline greenbelts help maintain a healthy aquatic ecosystem. A greenbelt consisting of a variety of native woody and herbaceous plant species provides habitat for near-shore aquatic organisms as well as other shoreline-dependent wildlife. Natural greenbelts help deter geese, as these shoreline guests tend to prefer well-manicured lawns with easy access to the water. Greenbelts also help stabilize shorelines against wave and ice action with their extensive network of deep, fibrous roots. Overhanging vegetation provides shade to nearshore areas, which is particularly important for many fisheries as well as insects the fish consume. Lastly, and perhaps most importantly, greenbelts provide a mechanism to filter pollutants carried by stormwater from rain events and snowmelt. Vegetation will utilize nutrients (nitrogen and phosphorus) for growth and filter them out of runoff before entering a lake.

Another pollutant and nutrient delivery mechanism to a lake is a tributary. The primary function of a tributary is to drain the landscape. Therefore, tributaries have a very high potential for influencing a lake's water quality as they are one of the primary conduits through which water is delivered to a lake within a watershed. Inlet streams may provide exceptionally high-quality waters that benefit the lake ecosystem. Conversely, they have the potential to deliver polluted waters that degrade the lake's water quality. Outlet streams flush water out of the lake, providing a way to remove contaminants in the lake ecosystem. While conducting shore surveys, noting inlet tributary locations is very helpful when evaluating shoreline algal conditions because nutrient concentrations are generally higher in streams than in lakes. The relatively higher nutrient levels delivered from streams often lead to naturally heavier *Cladophora* and other algal growth in nearby shoreline areas. Thayer Lake however, is not a drainage lake and does not contain a major inflow or outflow of water. Therefore, any excess

nutrients entering the lake would likely be driven by the local groundwater flow and nearby surface runoff.

Background of Study Area

Located in the northwestern area of the Lower Peninsula, Thayer Lake resides in central Antrim County. Thayer Lake has a surface area of just 106 acres and a shoreline length of 2.1 miles. A unique aspect of Thayer Lake is there are no primary tributaries flowing into the lake. Thayer Lake is known as a seepage lake. The primary inflow and outflow from the lake is via nearby surface runoff and groundwater flow. According to digitized bathymetry maps acquired from the Michigan Geographic Data Library, the deepest area of Thayer Lake is located near the center, reaching 18 feet in depth (Figure 1).

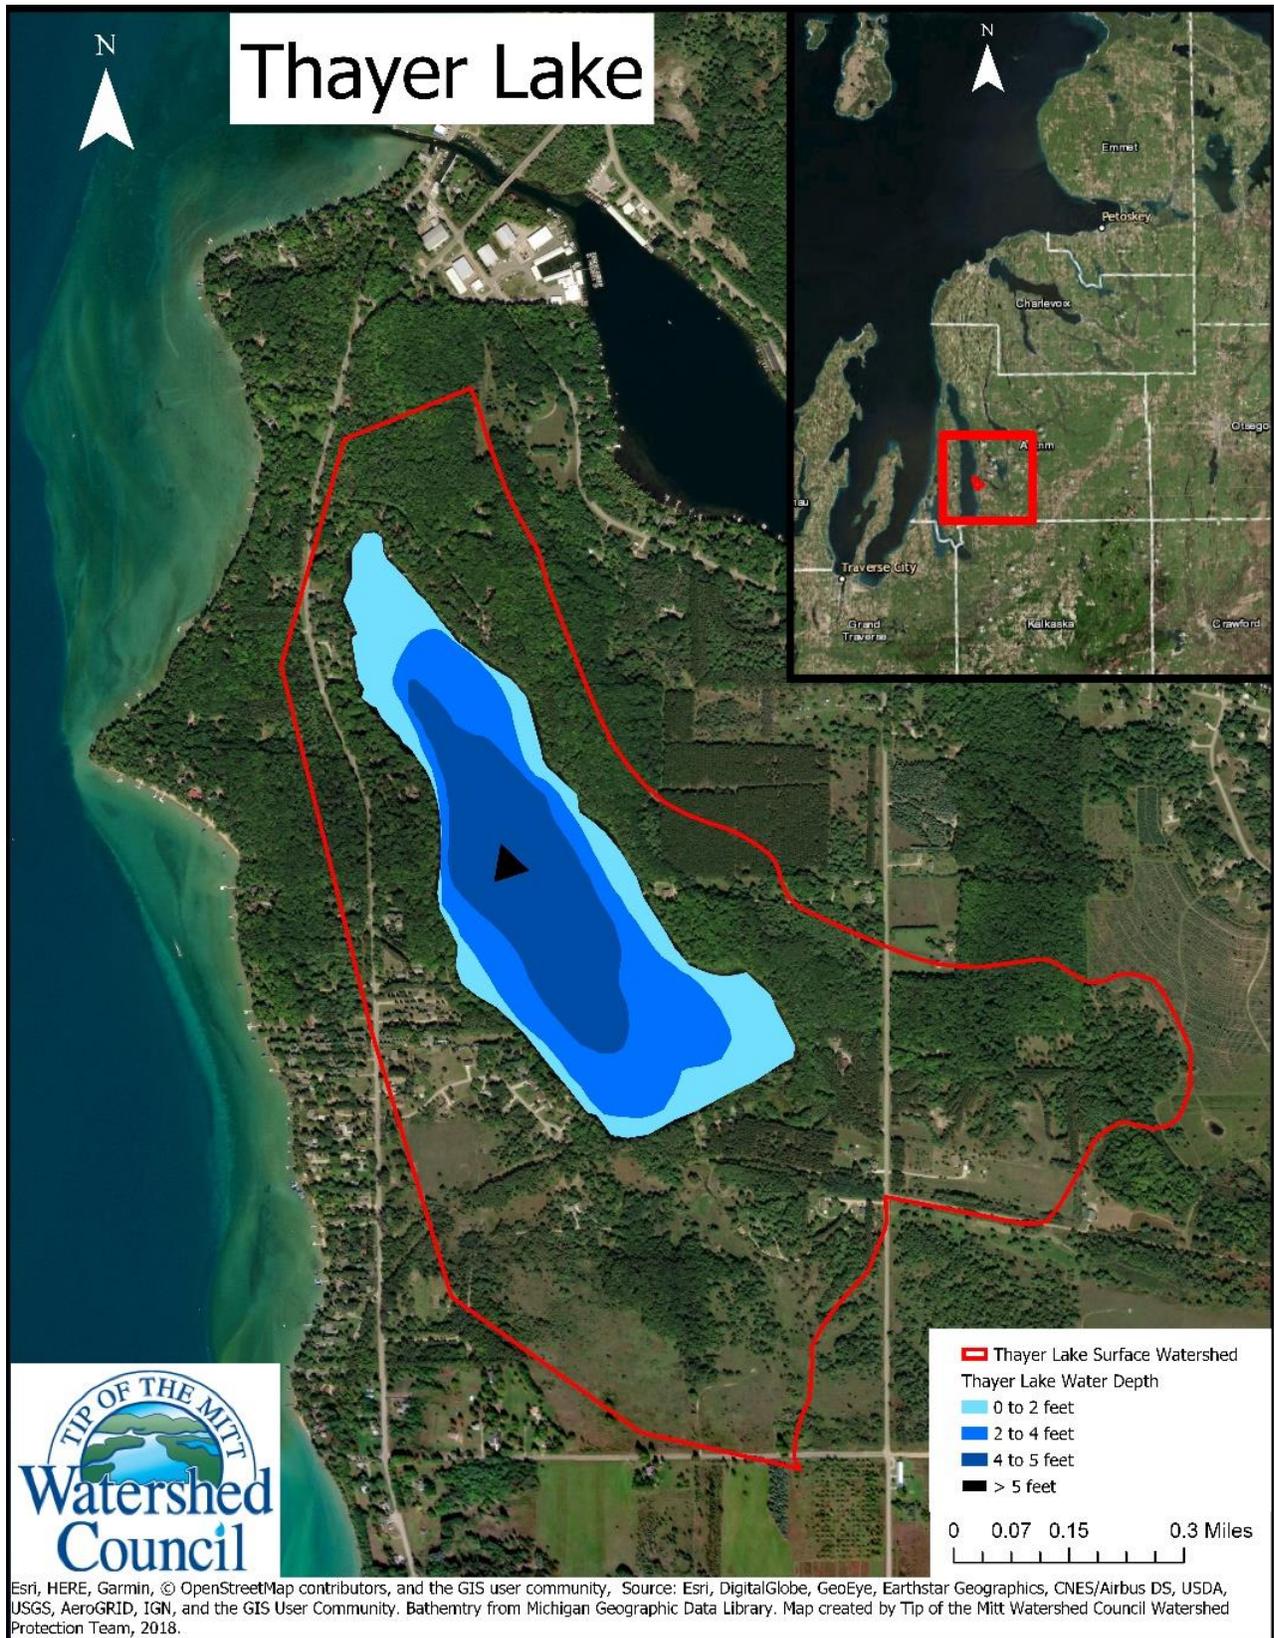


Figure 1 Map of Thayer Lake Depths (bathymetry) and surface watershed.

Land cover statistics generated for the surface watershed using data from the NOAA Coastal Great Lakes Land Cover Project reveal much of Thayer Lake’s Watershed land cover is forest (43.25%), grassland/herbaceous area (14.17), and agriculture (7.36%) (Table 2).

Table 1 Thayer Lake Surface Watershed Land Cover 2016

Land Cover Type	2016 (% of watershed)
Agriculture	7.36
Bare Land	0.49
Developed	2.92
Forest	43.25
Grassland/Herbaceous	14.17
Open Water	23.11
Pasture/Hay	0.05
Scrub/Shrub	5.86
Wetland	2.79

Water Quality Data

Volunteers have actively engaged with water quality monitoring programs coordinated by Tip of the Mitt Watershed Council. In addition, Watershed Council staff monitor Thayer Lake water quality as a part of their Comprehensive Water Quality Monitoring Program (CWQM).

Volunteer Lake Monitoring and CWQM data began in 2008 and 2013, respectively. Phosphorus has been monitored in Thayer Lake Since 2008 as part of an annual Lake Association partnership with the Watershed Council.

From these programs, data indicate Thayer Lake water quality is relatively good. Total phosphorous measurements show concentrations spiked in 2014-2015 (Figure 2) while nitrogen has decreased slightly, ranging between 420 – 660 µg/L (Figure 3). Chloride has remained around the 8.0mg/L and was slightly lower in 2016 than 2013 (Figure 4).

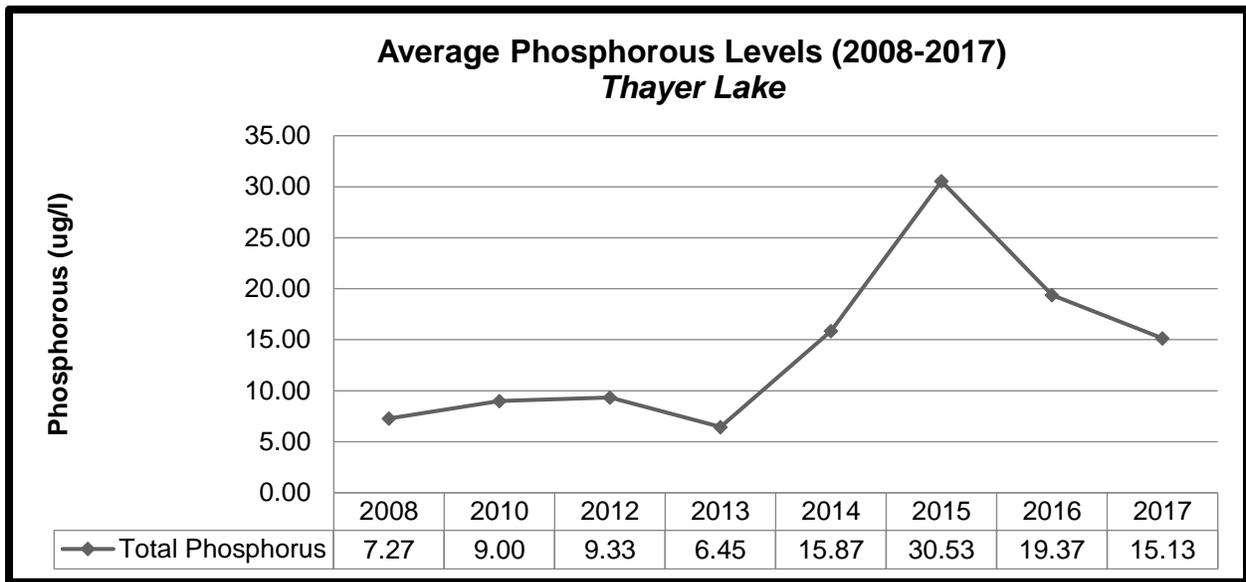


Figure 2 Thayer Lake Total Phosphorus Trends from 2008 through 2017

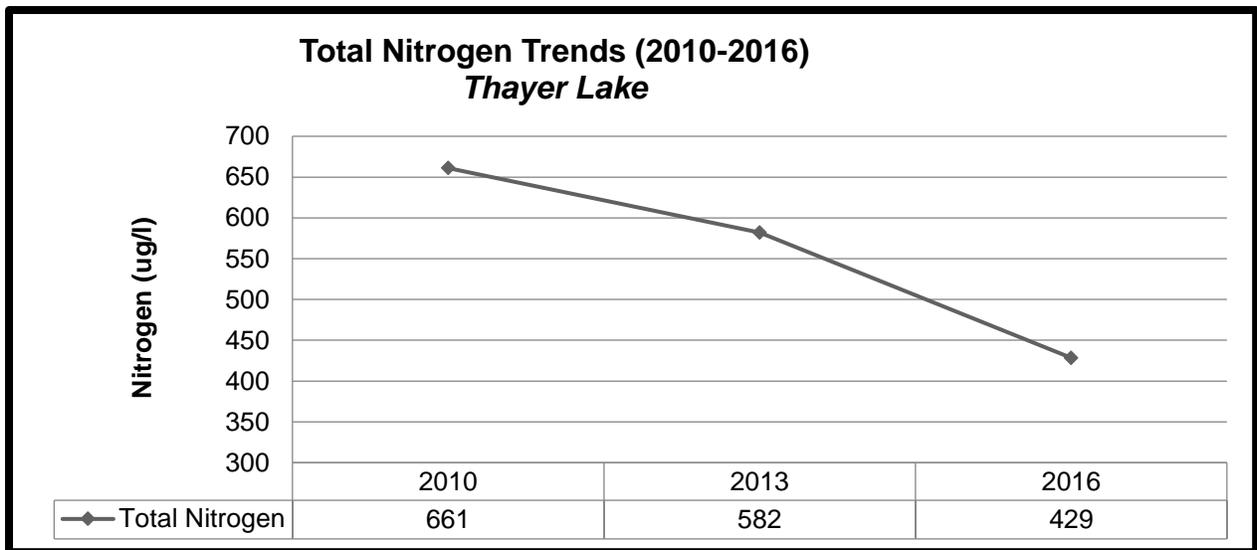


Figure 3 Thayer Lake Nitrogen Trends from 1995 through 2016

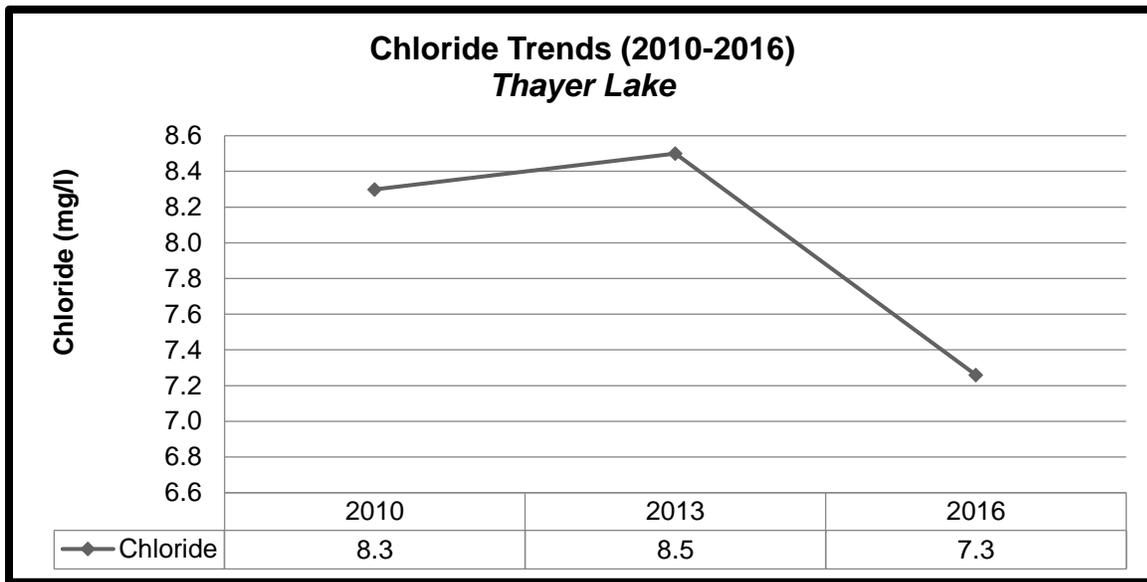


Figure 4 Thayer Lake Chloride Trends from through 2016

Since 2008, local volunteers have ventured out to Thayer Lake to record Secchi disk depth, water temperature, and collect water samples for *chlorophyll-a* measurements. These data align with above nutrient data. Since 2008, Thayer Lake appears to have become slightly more turbid, with Secchi disk readings decreasing from 12ft. in 2008 to a little under 10ft. in 2017 (Figure 5). The lowest water clarity was documented in 2015, the same year phosphorus and *chlorophyll-a* measurements showed a spike in concentrations. At the end of each sampling year, a trophic status index (TSI) is calculated (Figure 7). This value is a measure of biological productivity in a lake at the time of Secchi disk and *chlorophyll-a* sampling. A TSI value ranges from 0 to 100, where a score below 38 describes a lake devoid of nutrients, low biological productivity, and very clear water. A TSI score of 39 – 49 indicates a mesotrophic lake system. Mesotrophic simply means the lake has a moderate amount of nutrients. When nutrients become a problem and productivity becomes too high, a lake is considered “eutrophic” (TSI value above 50). Thayer Lake has been in the mesotrophic category, with a TSI value ranging between 41 and 48.

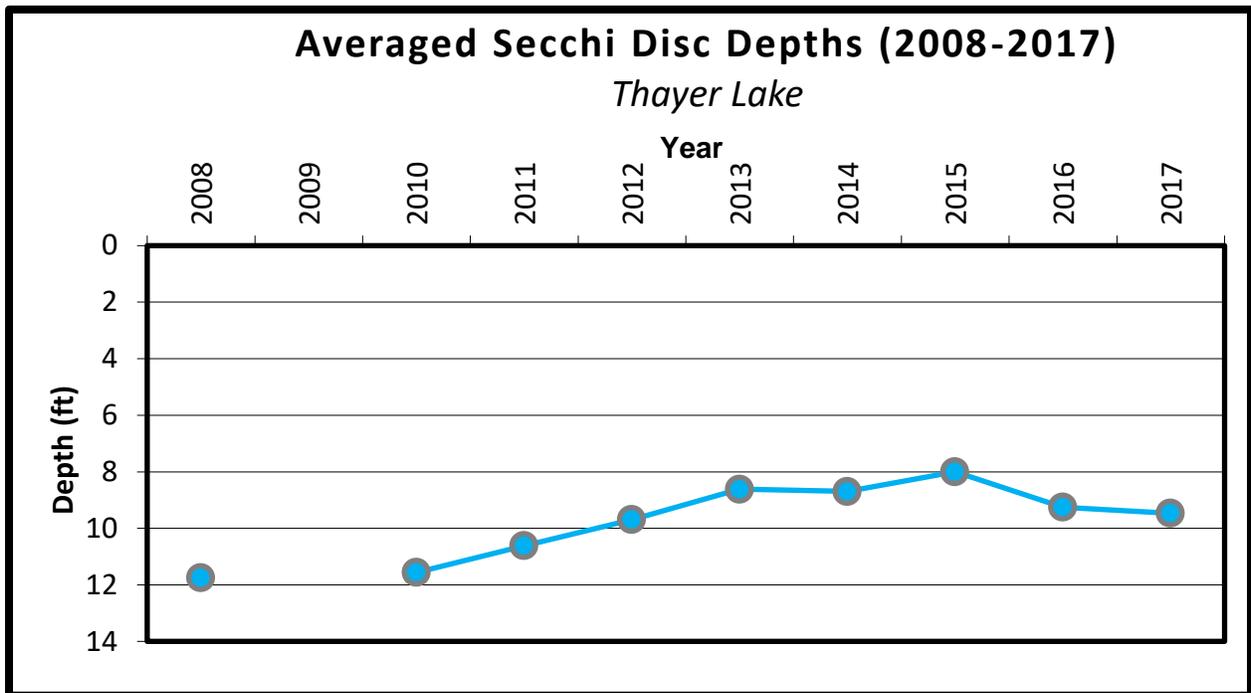


Figure 5 Average Secchi Disc depths collected by Thayer Lake Volunteers since 2008

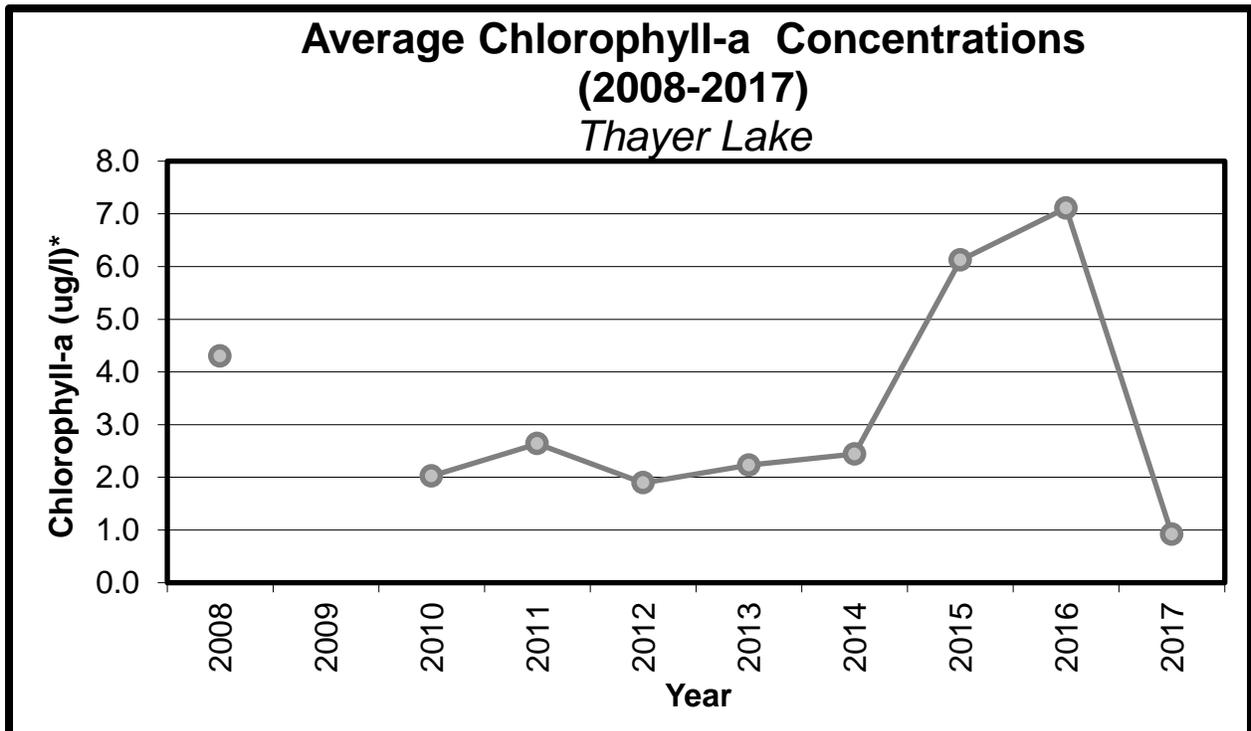


Figure 6 Average Chlorophyll-a concentrations collected by Thayer Lake Volunteers. Missing values indicate data not available for that particular year

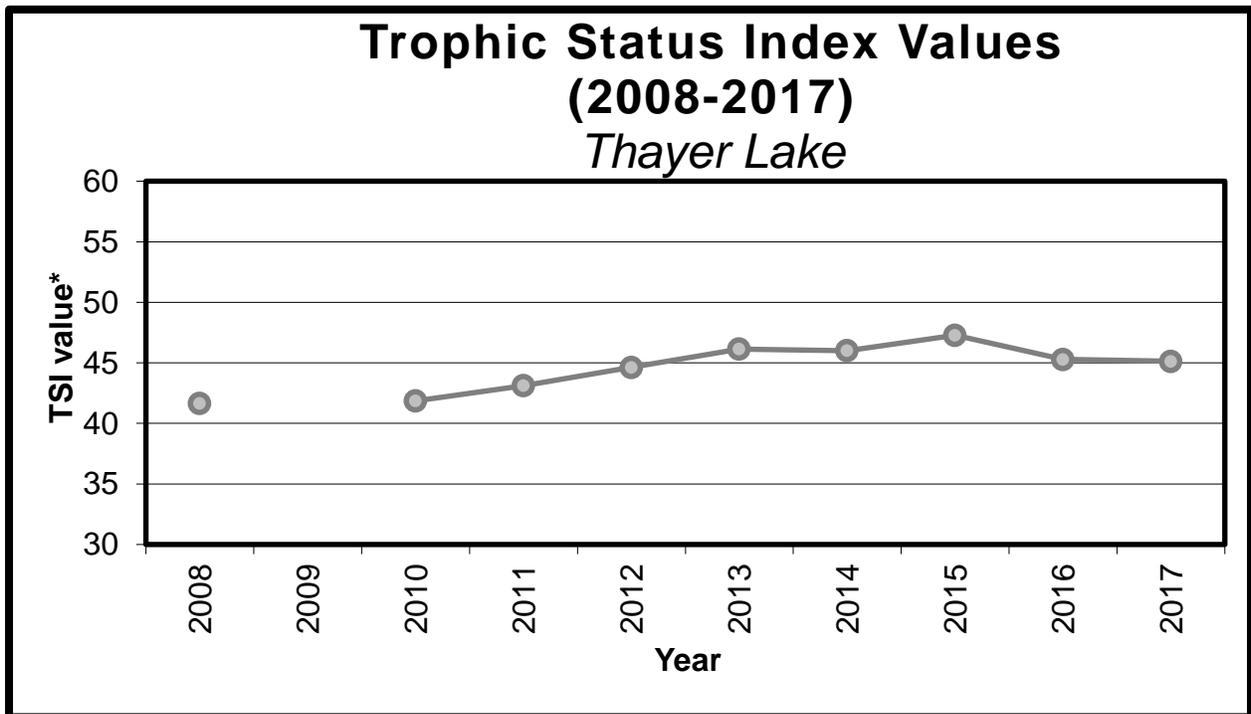


Figure 7 Trophic Status Index (TSI) from data collected by Thayer Lake Volunteers since 2008

SHORELINE SURVEY METHODS

Thayer Lake was surveyed by kayak during June and July of 2017 to document shoreline conditions. Shoreline conditions were surveyed by traveling as close to the shoreline as possible (usually within 20 feet) and noting *Cladophora* growth, substrate type, erosion conditions, greenbelt length, greenbelt depth, shoreline alterations, and tributaries. All information was recorded on field data sheets and subsequently compiled into a database. Field photos were geotagged, and recorded field data were linked to spatial data and in ESRI ArcGIS (v10.5.1) for analyses to be conducted to show where good and bad areas exist around Thayer Lake.

Parameters

Shoreline property features were documented by photographing and noting physical features on a data sheet. Developed parcels were noted on field data sheets and included as a separate column in the database. Properties described as developed indicate the presence of buildings or other permanent structures, including roadways, boat launching sites, and recreational

properties (i.e.- parks with pavilions and parking lots). Properties with only mowed or cleared areas, seasonal structures (such as docks or travel trailers), or unpaved pathways were not considered developed. Additionally, large parcels that had structures in an area far from the water's edge were not considered developed. The length and area of developed versus undeveloped shoreline was not calculated. After noting development status, *Cladophora* was identified in the area.

Many species of filamentous green algae are commonly found growing in the nearshore regions of lakes. Positive identification of the species usually requires the aid of a microscope. However, *Cladophora* usually has a unique appearance and texture that is quite distinct to a trained surveyor. These were the sole criteria upon which identification was based. Other species of filamentous green algae can respond to an external nutrient source in much the same way as *Cladophora*, though their value as an indicator species is not thought to be as reliable. When other species occurred in especially noticeable, large, dense growths, they were recorded on the data sheets and described the same as those of *Cladophora*.

When *Cladophora* was observed, it was described in terms of the length of shoreline with growth, the relative growth density, and any observed shoreline features potentially contributing to the growth. Both shoreline length and growth density are subjective estimates. Growth density is determined by estimating the percentage of substrate covered with *Cladophora* using the following categorization system:

Table 2 Categorization system for Cladophora density

Density Category	Field Notation	Substrate Coverage (%)
Very Light	(VL)	0 *
Light	(L)	1- 20
Light to Moderate	(LM)	21-40
Moderate	(M)	41-60
Moderate to Heavy	(MH)	61-80
Heavy	(H)	81-99
Very Heavy	(VH)	90-100 *

*Very Light is noted when a green shimmer is noticed on hard substrate, but no filamentous growth present. Very Heavy overlaps with heavy and is distinguished by high percentage of substrate coverage and long filamentous growth.

Among other things, the distribution and size of each *Cladophora* growth is dependent on the amount of suitable substrate present. The extent of suitable substrate should therefore be taken into account when interpreting the occurrence of individual growths, and assessing the overall distribution of *Cladophora* along a particular stretch of shoreline. Substrate types were noted during the survey, using the following abbreviations: m = soft muck or marl, s = sand, g = gravel (0.1" to 2.5" diameter), r = rock (2.5" to 10" diameter), b = boulder (>10" diameter), and w = woody debris. Substrate suitable for *Cladophora* growth include the g, r, b, and w types. However, the extent of suitable substrate along a shoreline parcel in terms of distance was not documented. Erosion conditions were similarly noted along each shoreline.

Erosion was noted based on shoreline areas that exhibited: areas of bare soil, leaning or downed trees, exposed tree roots, undercut banks, slumping hunks of sod, excessive deposits of sediments, or muddy water. Similar to *Cladophora*, shoreline erosion was recorded on field data sheets with extent and relative severity estimates (light, moderate, or heavy/severe). For example "Mx20" indicated 20 feet of shoreline with moderate erosion. Additional information about the nature of the erosion, such as potential causes, were also noted.

Minor: exposed soils, gullies up to 1" deep.

Moderate: exposed soils, gullies > 1" & < 6", banks undercut by <6", minor slumping.

Severe: exposed soils, gullies > 6", banks undercut by > 6", severe slumping, tree fall

Greenbelts were rated based on the relative length of shoreline with a greenbelt and the average depth of the greenbelt from the shoreline into the property. Ratings ranged from zero to four and were based on the following.

Length 0: None, 1: 1-10%, 2: 10-25%, 3: 25-75%, 4:>75%

Depth 0: None, 1: <10 ft, 2: 10-40 ft, 3: >40 ft

Greenbelt ratings for length and depth were summed to produce an overall greenbelt score.

Tributaries were noted on the field data sheets and included in a separate column in the database. Additional information was included in the database in a “comments” column. The comments column also included notes about shoreline alterations. Shoreline alterations (structures) were noted with the following abbreviated descriptions:

SB = steel bulkhead (i.e., seawall)

CB = concrete bulkhead

WB = wood bulkhead

BB = boulder bulkhead

RR = rock rip-rap

BH = permanent boathouse

DP = discharge pipe

Data Processing

Upon completion of surveying the entire Thayer Lake shoreline, all field data were transferred to a Microsoft Excel® workbook. Digital photographs and GPS data were uploaded to a computer and processed for use. Linking field and equalization data allows shoreline conditions documented during the survey to be referenced by parcel identification number or parcel owner name. Field data were linked to Antrim County parcel data in a Geographic Information System (GIS) with the aid of GPS and photographs.

In order to display survey results without pinpointing specific parcels, a new map layer was developed using the parcel map data layer acquired from the county equalization department and a Thayer Lake shoreline layer. The new map layer consists of a narrow band following the shoreline, split into polygons that contain field and equalization data. This data layer was overlaid with other GIS data from the State of Michigan to produce the maps contained in this report.

RESULTS

Following are results of the 2017 survey documenting shoreline conditions at 61 parcels on Thayer Lake. Approximately 77% (47) of shoreline properties on Thayer Lake were considered developed.

Cladophora

Noticeable growths of *Cladophora* or other filamentous green algae were found along the shoreline at 7 parcels (11% of total parcels surveyed; Table 3). At properties where *Cladophora* growth was observed, 4 parcels consisted of light or very light growth, while 3 parcels had moderate to heavy growth. The few patches of *Cladophora* growth were located along the Northern shores of Thayer Lake (Figure 8).

Table 3 Cladophora density results

<i>Cladophora</i> Density	Parcels	Percent of total parcels (%)
Very light	1	<2
Light	3	5
Light to Moderate	0	0
Moderate	2	3
Moderate to Heavy	0	0
Heavy	1	<2
Very Heavy	0	0

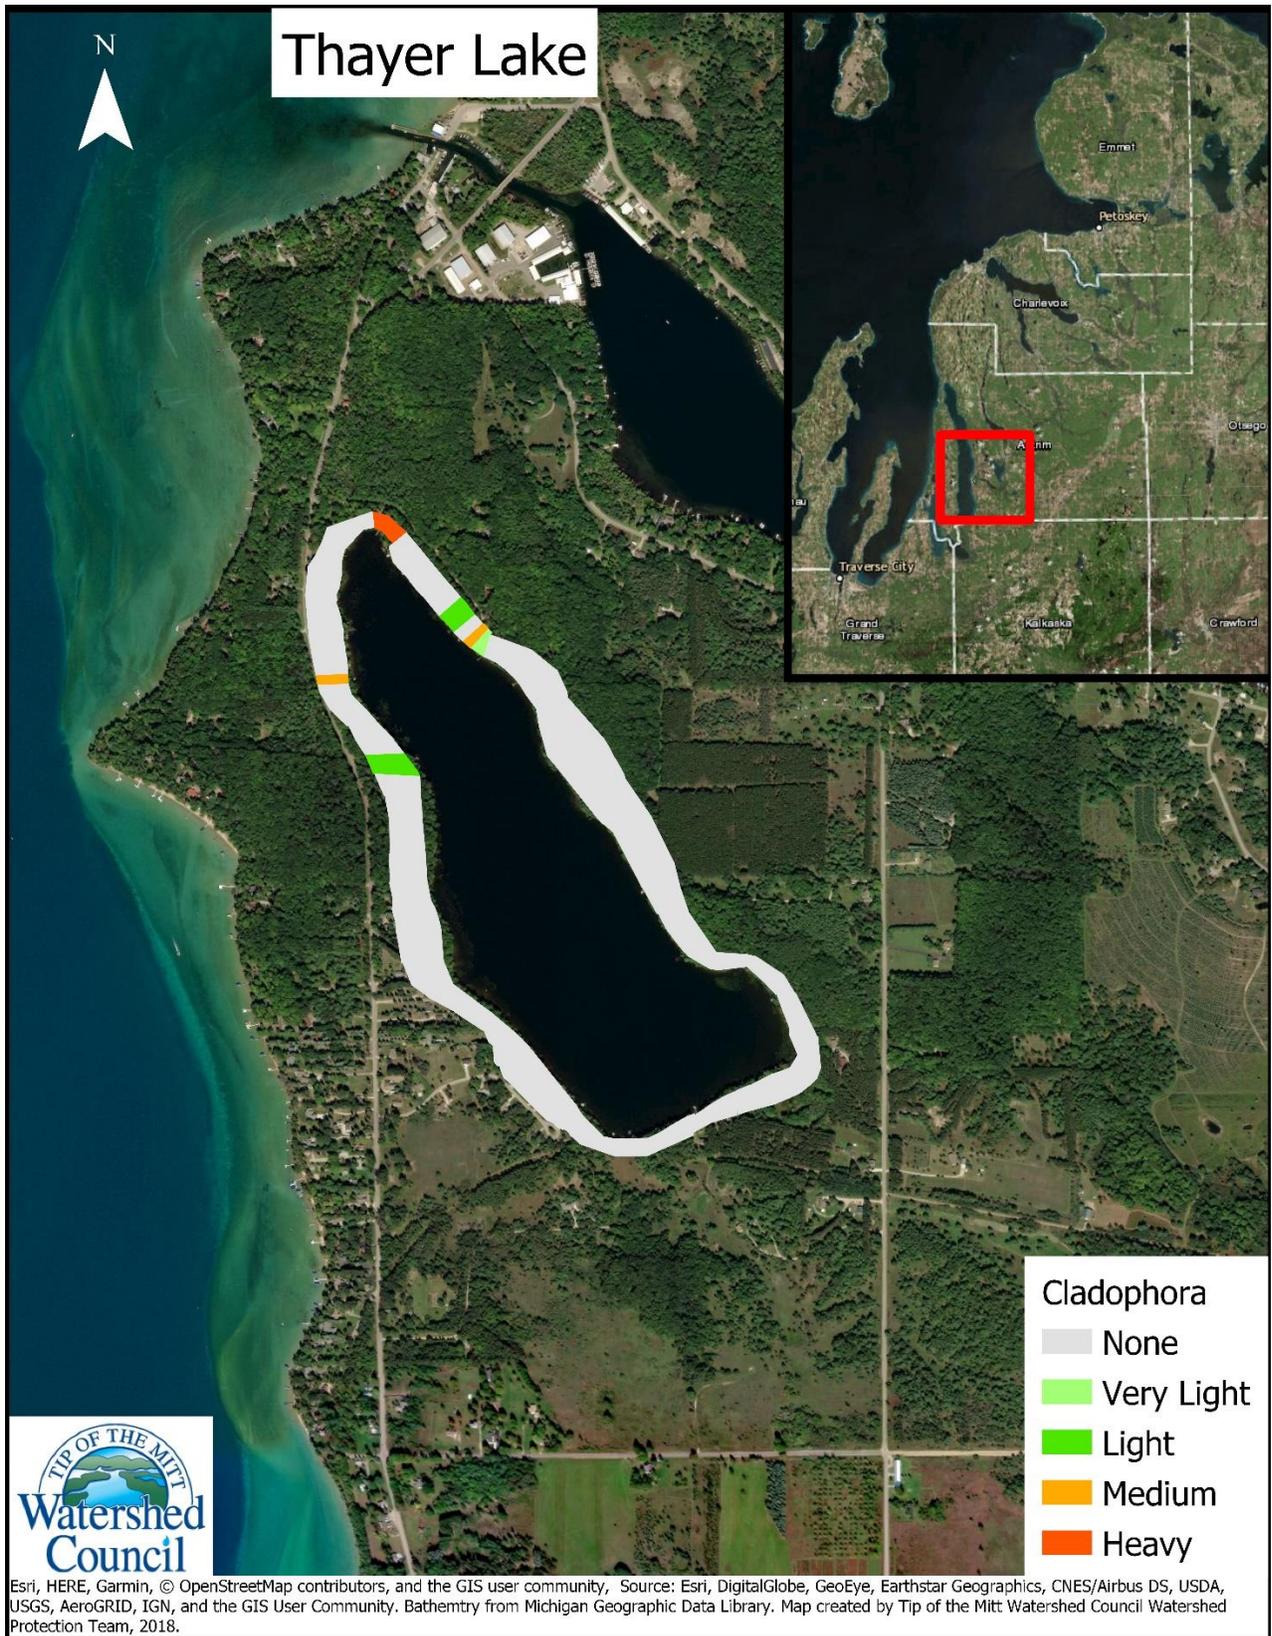


Figure 8 Cladophora density around Thayer Lake Shoreline

Greenbelt Scores

Greenbelt scores ranged from 0 (little to no greenbelt) to 7 (exemplary greenbelt). Thayer Lake greenbelts were generally observed to be in good or excellent condition (71%, table 4). Of 61 surveyed, 10 parcels (16%) received a greenbelt rating in the poor or very poor categories.

Table 4 Greenbelt rating results

Greenbelt Rating		Number of Parcels	Percent (%)
0	Very Poor (absent)	6	10
1-2	Poor	4	6
3-4	Moderate	8	13
5-6	Good	29	48
7	Excellent	14	23

Greenbelt status varied around Thayer Lake. However, clusters of properties along the northern shoreline were ranked in the very poor (absent) to poor categories (Figure 9). Large parcels along the eastern shoreline showed good greenbelts while clusters along the western and southern shoreline were in the excellent rating.

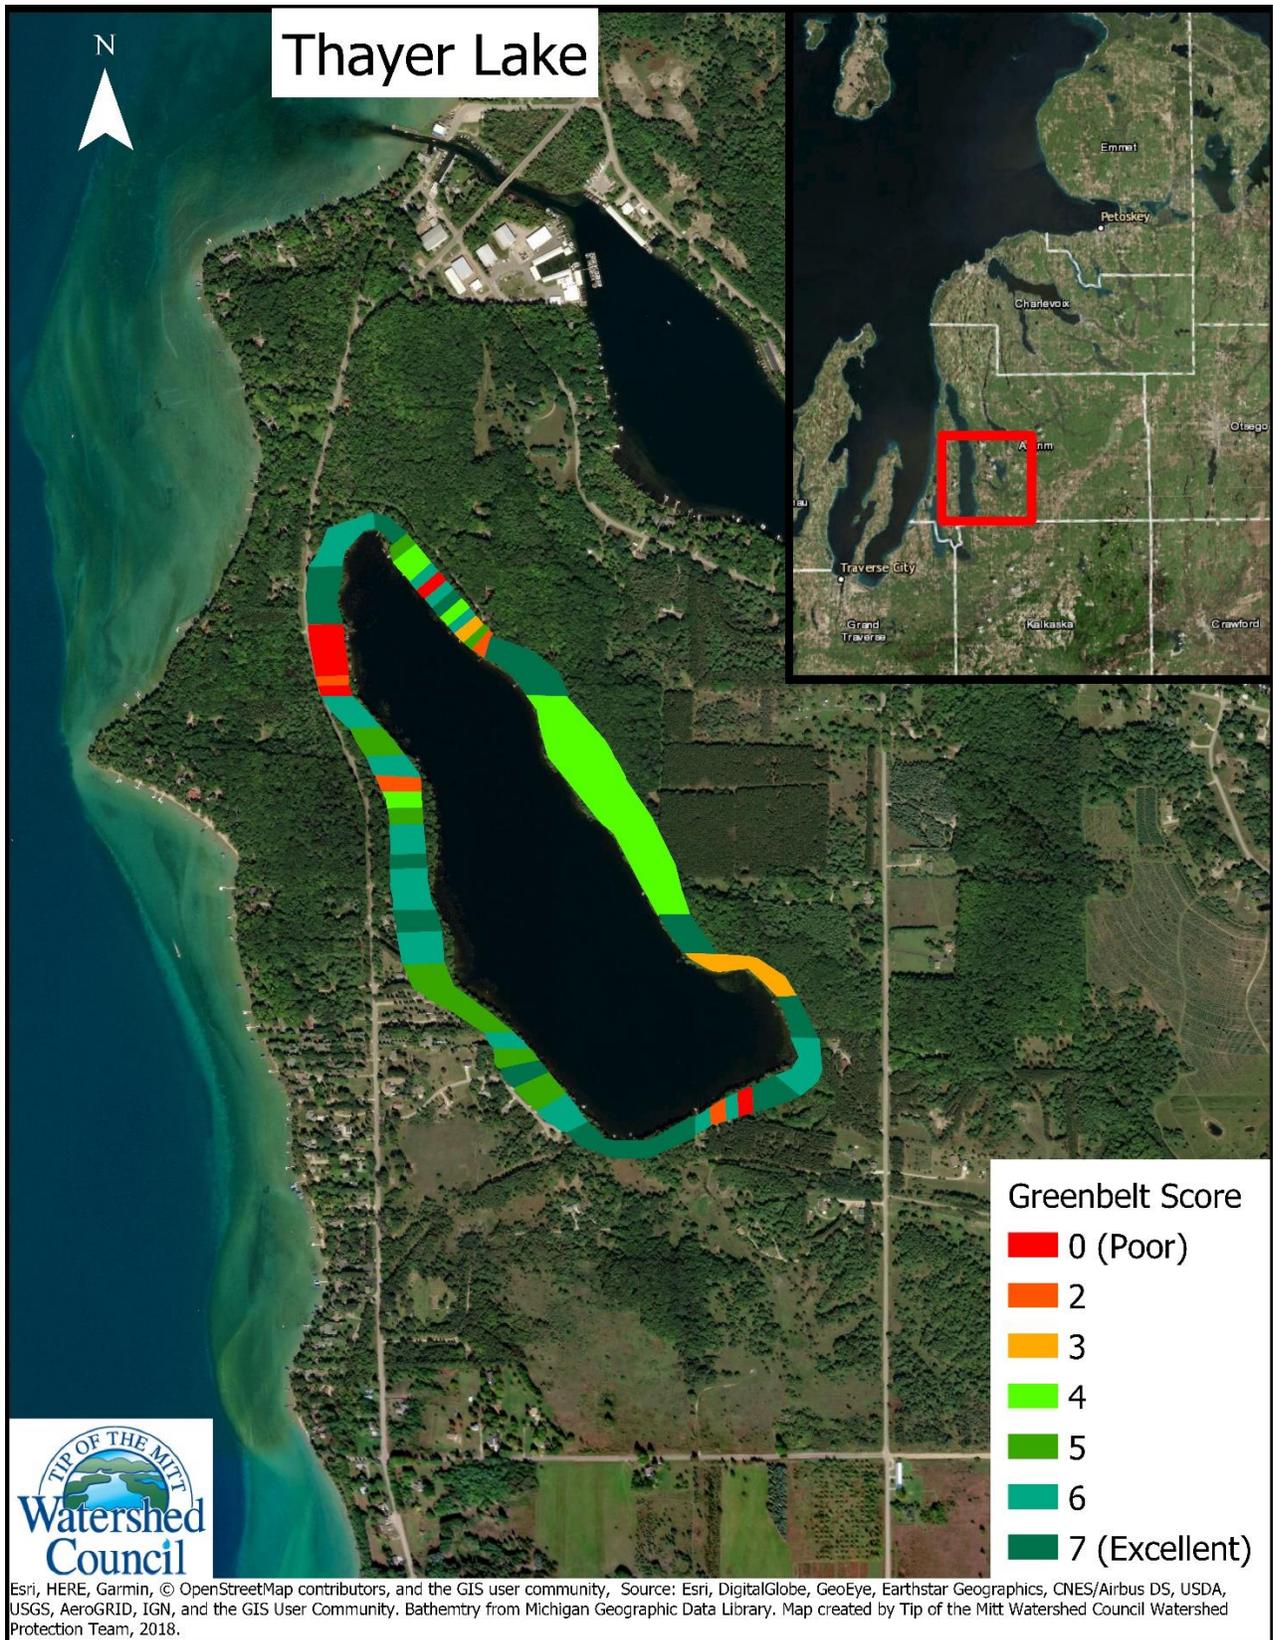


Figure 9 Greenbelt Scores around Thayer Lake shoreline

Shoreline alterations

Some form of shoreline alteration was noted at 22% (14 parcels) of shoreline properties (Table 6). Of the alterations, 8 parcels noted cobble re rip-rap.

Table 5 Shoreline alteration results

Alteration Type	Number of Parcels*	Percent With Alteration (%)*
Riprap (cobble)	8	13
Riprap (boulder)	1	1
Mixed riprap	0	0
Seawalls	2	3
'Artificial' Beach Sand	3	5
Discharge Pipes	0	0
Unaltered	47	77

**Numbers and percentages quantify alteration type, some parcels could have multiple alterations*

Erosion

Erosion was noted at 20 parcels (32%) on the Thayer Lake shoreline (Table 6). Most of the erosion (37%) was classified as minor in terms of severity, while less than 1% of properties were considered severe. (Figure 10).

Table 6 Shoreline erosion severity results

Erosion Category	Number of Properties	Percent of Properties (%)
Light	16	26
Medium	4	6

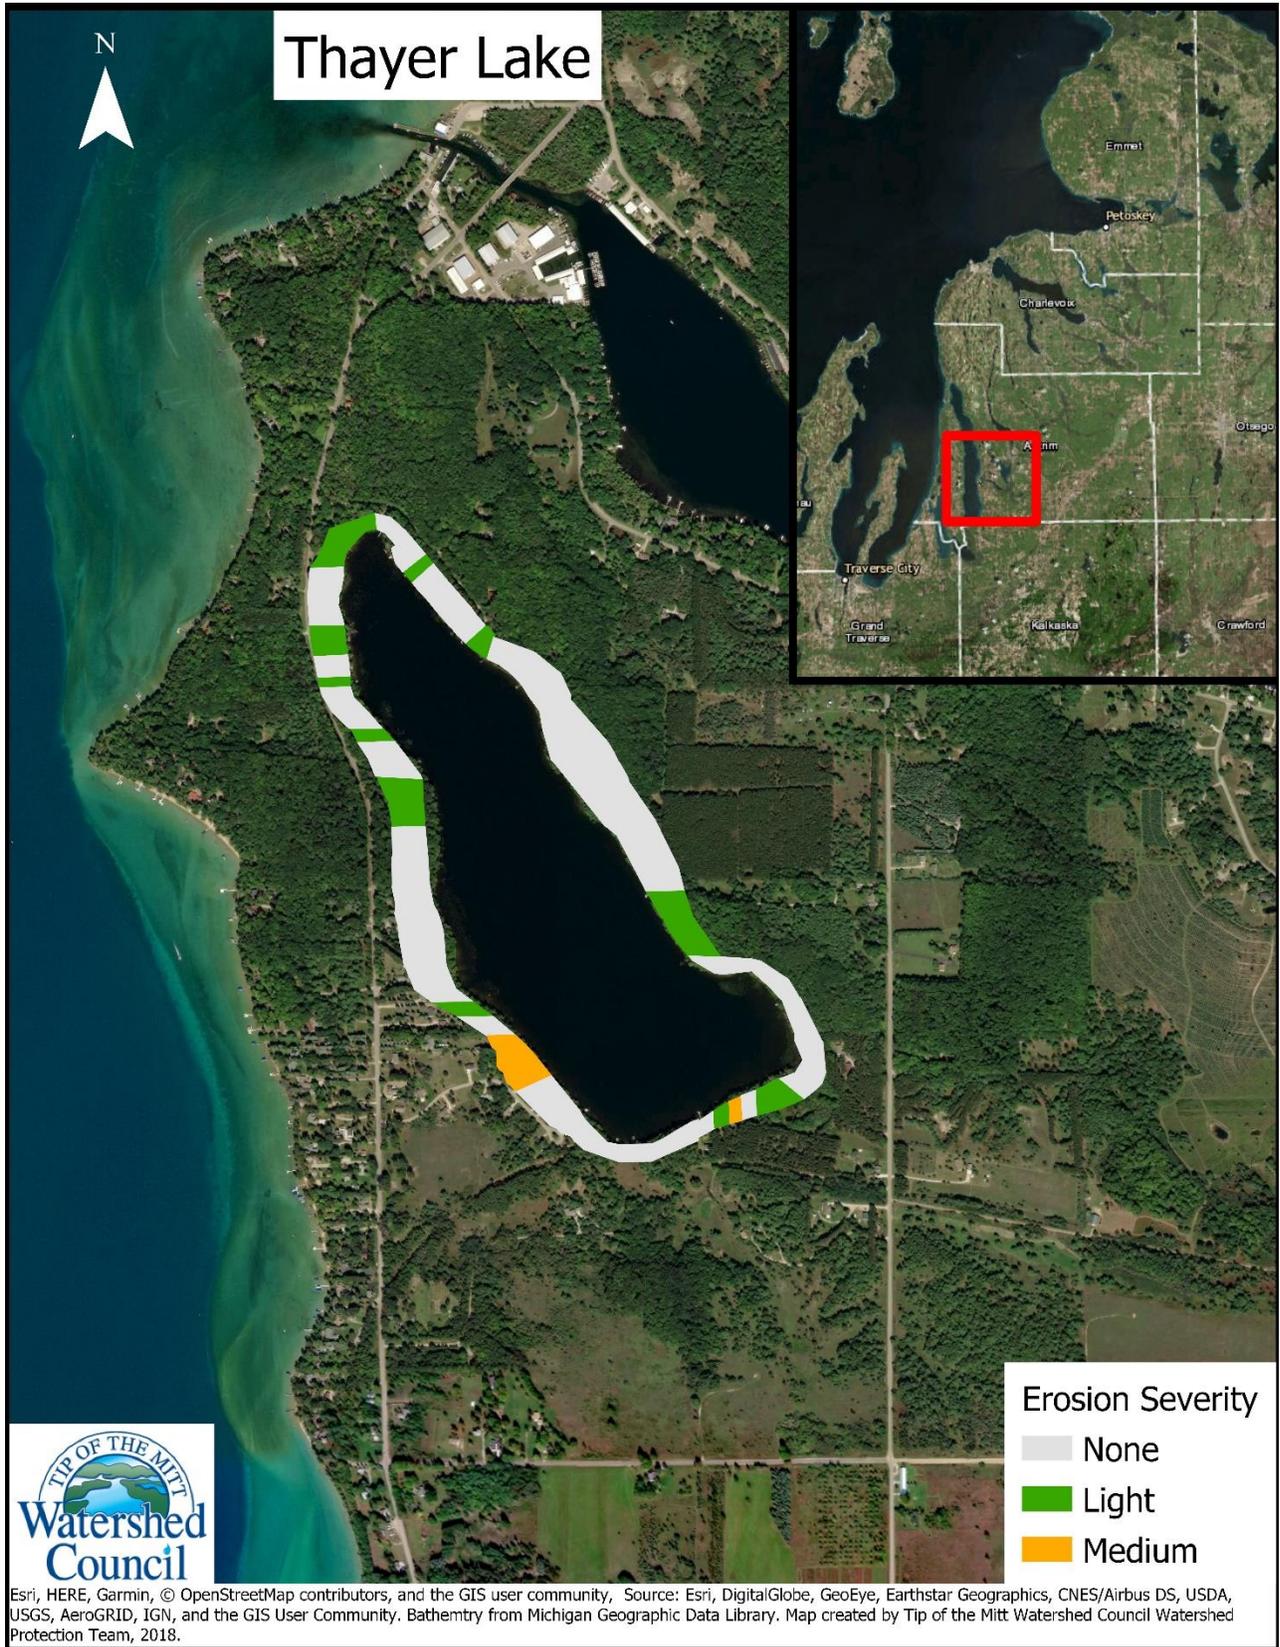


Figure 10 Erosion severity around Thayer Lake shoreline

DISCUSSION

In general, development of shoreline parcels can negatively impact a lake's water quality due to a multitude of factors. For Thayer Lake, the lack of native vegetation at water's edge and septic leakage for some parcels might be the greatest threat. The most serious impacts to water quality include:

- 1) Loss of vegetation that would otherwise absorb and filter pollutants in stormwater runoff as well as stabilize shoreline areas and prevent erosion.
- 2) Increased impervious surface area such as roofs, driveways, and roads, which leads to greater inputs of stormwater runoff and associated pollutants.
- 3) Waste and byproducts of human activity such as septic leachate, fertilizers, and decomposing yard waste that potentially reach and contaminate the lake water.

Clearly, there are many problems associated with development, but there are also many solutions for reducing or even eliminating impacts. Numerous best management practices have been developed that help minimize negative impacts to water quality and can be utilized during or after the development of shoreline parcels. A buffer of diverse, native plants can be planted/maintained along the shoreline to filter pollutants and reduce erosion. Impacts from stormwater generated from roofs, roads, and driveways can be reduced using rain barrels, rain gardens, grassy swales, and many other techniques. Leachate reaching the lake from septic systems can be minimized by pumping the septic tank regularly, having all components of the septic system inspected regularly, and replacing the septic system when necessary. Mulch can be composted far from the shoreline and fertilizers applied sparingly, if at all.

Results from the 2017 shoreline survey indicate that some of the aforementioned issues may pose a threat to the water quality and overall health of Thayer Lake. Removal of shoreline vegetation and erosion are the main concerns. Algal growth as an indicator of nutrient pollution are far less extensive than the above issues. Future work should document what the nutrient load is to Thayer Lake as this information is relatively unknown. Fortunately, wetland areas

surrounding Thayer Lake have remained intact.

Wetlands are incredibly important as they provide habitat for insects and other macroinvertebrates, amphibians and reptiles, waterfowl, and fish. Fish use wetlands as sources of food, protection from predators, and as spawning grounds. Waterfowl rely heavily on wetland areas during times of migration, to find food, and as protection. Wetland areas essentially act as a “nutrient sponge” and significantly help filter nutrients such as phosphorus and nitrogen before water enters Thayer Lake. Resiliency of Thayer Lake water quality could very well depend on the wetland areas immediately surrounding the lake. Another issue to consider is septic system maintenance.

Outreach regarding septic system maintenance, phasing out of old systems, and properly siting new systems may be playing a role in reduction in nutrient pollution related to septic systems. Where human-caused nutrient pollution is occurring, the source has to be identified in order to address the problem. Although impeded by factors such as wind, wave action, currents, and groundwater paths, efforts by trained personnel to identify specific nutrient input from septic systems on individual properties are often successful.

Further improvements would benefit the lake’s ecosystem and reduce impacts associated with increasing lakeshore development. The easiest, and perhaps most beneficial way would be to have native vegetation at water’s edge. A lack of vegetation on the lake’s shoreline, which provides habitat and acts as a food source, can impact the abundance and diversity of aquatic organisms, ranging from minute crustaceans to top tier predator fish. Furthermore, the absence of vegetation can lead to increased shoreline erosion and less filtration of pollutants. Although a large number of greenbelts are in poor condition, 11% of properties received a perfect score, indicating exemplary greenbelt health. Properties with healthy, intact greenbelts provide a model for improvement for other shoreline properties. Compared to other lakes in the region, Thayer Lake has a relatively low number of parcels exhibiting shoreline alterations, poor greenbelts, and *Cladophora* growth (Table 7).

Table 7 Shore Survey statistics from Northern Michigan Lakes

Lake Name	Survey Date	<i>Cladophora</i> *	Heavy Algae*	Erosion*	Poor Greenbelts*	Alterations*
Beals Lake	2016	0%	0%	0%	17%	0%
Ben-Way Lake	2016	3%	0%	84%	47%	40%
Burt Lake	2009	47%	29%	4%	36%	46%
Bellaire Lake	2017	35%	1%	27%	30%	55%
Charlevoix, Lake	2012	22%	19%	14%	34%	79%
Clam Lake	2017	48%	5%	30%	51%	55%
Crooked Lake	2012	29%	26%	14%	51%	65%
Douglas Lake	2015	27%	6%	17%	53%	60%
Elk Lake	2017	84%	2%	52%	30%	87%
Ellsworth Lake	2016	40%	14%	38%	24%	23%
Hanley Lake	2016	11%	0%	33%	19%	23%
Huffman Lake	2015	14%	0%	7%	57%	70%
Huron, Duncan Bay	2013	41%	2%	19%	45%	63%
Huron, Grass Bay	2013	0%	0%	4%	0%	8%
Intermediate Lake	2016	19%	9%	53%	63%	77%
Lance Lake	2014	19%	0%	12%	35%	31%
Larks Lake	2006	4%	0%	ND	12%	29%
Mullett Lake	2016	44%	6%	36%	59%	76%
Pickerel Lake	2012	27%	33%	15%	52%	64%
Round Lake	2014	21%	0%	27%	44%	44%
Scotts Lake	2016	0%	0%	2%	18%	7%
Silver Lake	2014	3%	0%	70%	53%	65%
Skegemog Lake	2017	52%	5%	40%	46%	76%
St. Clair Lake	2016	4%	0%	13%	34%	21%
Six Mile Lake	2016	10%	24%	13%	41%	37%
Thayer Lake	2017	11%	1%	32%	16%	22%
Thumb Lake	2007	4%	0%	ND	ND	39%
Torch Lake	2017	39%	5%	26%	20%	ND
Walloon Lake	2016	62%	2%	17%	39%	80%
Wildwood Lake	2014	5%	0%	22%	45%	50%
Wilson	2016	27%	5%	29%	11%	14%
AVERAGE	NA	24%	6%	26%	36%	47%

*Percentages are in relation to number of parcels on the lake shore, except for “heavy algae”, which is the percent of only parcels that had *Cladophora* growth. Erosion is the percentage of parcels with moderate to severe erosion and poor greenbelts include those in the poor or very poor categories. ND=no data.

Although many properties on Thayer Lake are experiencing some form of erosion, the majority (82% of all erosion sites) are considered minor and less than 3% of all erosion is considered to be severe. Many properties with patches of lawn at water's edge experience a minor undercutting caused by waves and ice shove. Properties with artificial beach sand usually experience some loss of sand into the Lake, evidenced by small erosional rills leading into the Lake. Although not catastrophic, these types of minor erosion do have the ability to degrade the water and habitat quality of Thayer Lake. To prevent changes to the lake ecosystem, changes should be made in shoreline property management. Mismanagement of shoreline properties can degrade the lake's water quality, diminish fisheries, and even create an environment that poses threats to human health. Therefore, Tip of the Mitt Watershed Council offers a number of recommendations.

RECOMMENDATIONS

The full value of a shoreline survey is only achieved when the information is used to educate riparian property owners about preserving water quality, and to help them rectify any problem situations. The following are recommended follow-up actions:

1. Keep the specific results of the survey confidential (e.g., do not publish a list of sites where *Cladophora* algae were found) as some property owners may be sensitive to publicizing information regarding their property.
2. Send a general summary of the survey results to all shoreline residents.
3. Organize and sponsor an informational session to present findings of the survey to shoreline residents and provide ideas and options for improving shoreline management practices that would help protect and improve the Lake's water quality.
4. Inform owners of properties with heavy *Cladophora* growths of specific results for their property, ask them to fill out a questionnaire in an attempt to interpret causes of the growth, and offer individualized recommendations for water quality protection.
5. Inform owners of properties with poor greenbelt scores and those with severely eroded shorelines of specific results for their property. Supply these property owners with

information (e.g., brochures) regarding the benefits of greenbelts and/or the problems associated with erosion. Encourage property owners to improve greenbelts using a mix of native plants and to correct erosion problems. Property owners can contact the Watershed Council for more information on how to improve greenbelts and/or correct erosion problems.

6. Utilize the Internet and other organizations' websites to share survey information. A general summary report and this detailed report can be posted on websites because they do not contain any property-specific information. Property-specific information can be shared by randomizing and encrypting the shoreline survey database and providing property owners with a code number that refers specifically to survey results from their property. The Watershed Council is available to assist with this approach.
7. Continue to support the Tip of the Mitt Watershed Council Volunteer Lake and Stream Monitoring programs by providing volunteer support. The information collected by volunteers is extremely valuable for evaluating water quality and determining trends. Lake residents are encouraged to continue supplying volunteer help and volunteers should attend training sessions held by the Watershed Council to ensure that a complete set of quality data is being collected each year.
8. Repeat some version of the survey periodically (ideally every 5 - 10 years), coupled with the follow-up activities described previously, in order to promote water quality awareness and good management practices on an ongoing basis. During each subsequent survey, more details about shoreline features are added to the database, which can be utilized for other water resource management applications.
9. The Michigan Natural Shoreline Partnership has developed a new educational tool called the Michigan Shoreland Stewards Program, which is a voluntary web-based survey designed to educate shoreline property owners on the importance of lake-friendly management practices. The survey asks questions related to management practices in each of the four sections of a shoreland property: upland, buffer, shoreline and lake. Responses to the questions are rated to determine the shoreland steward recognition level. A gold, silver, bronze or starter level rating can be achieved.

Encourage Thayer Lake residents to visit www.mishorelandstewards.org to take the survey.

LITERATURE AND DATA REFERENCED

National Oceanic and Atmospheric Administration (NOAA). 2017. Coastal Great Lakes Land Cover Project. NOAA Coastal Services Center. Charleston, SC.
<http://www.csc.noaa.gov/crs/lca/greatlakes.html>

Tip of the Mitt Watershed Council. 2016. Comprehensive Water Quality Monitoring Program Data. Tip of the Mitt Watershed Council. Petoskey, MI.
<http://www.watershedcouncil.org/Protect/>

Tip of the Mitt Watershed Council. 2017. Volunteer Lake Monitoring Program Data. Tip of the Mitt Watershed Council. Petoskey, MI. <http://www.watershedcouncil.org/Protect/>

Antrim County Equalization/GIS. 2015. Antrim County GIS Parcel Data. Bellaire, MI.
<http://www.emmetcounty.org/>

Michigan Department of Natural Resources. 2008. Lake Maps by County. Lansing, MI.
http://www.michigan.gov/cgi/0,1607,7-153-30301_31431_32340---,00.html